

Car Seat Recalls/Defects & Safety Notices

Revised 6/26/2003



This list covering child car seats manufactured after 1/1/81 was compiled by the Safety Restraint Coalition (425) 828-8975 or 800-282-5587 (Washington State only). We endeavor to keep this list accurate and up-to-date however, information from manufacturers may change without our knowledge. Call the manufacturer to verify information. The most recent addition(s) are shaded.

- Alkot** See Love Seat
- All Our Kids** Out of Business
Travel Vest, all models. Fails flammability. Destroy!
- Am. Motors** See Love Seat
- Angel Guard** 330-723-5928
Medina, OH 44256
- Babyhood** Out of Business
Baby-Sitter model 8200 made 1/92-6/93. Problem: Buckle can be hard to release. Destroy!
Wonda Chair model 810 pre-12/82. Problem: Harness may be mis-routed. Destroy!
- Basic Comfort** 800-456-8687
445 Lincoln Street
Denver, CO 80203
Galaxy 2000 Boosters all models Problem #1: Improperly positioned shoulder belt may increase risk of injury. Call: 800-456-8687 for new instructions. Problem #2: Made 11/25/98-1/31/99 Defective backs & cushions may become brittle. Call: 800-640-8469 for parts & instructions.
- Bobby Mac** See Evenflo
- Bolform** Out of Business
Buckle Up Harness 84E-019 failed crash test. Destroy!
- Britax** 888-427-4829
15501 South Ridge Drive,
Charlotte, NC 28273
Roundabout Convertible model 161 manufactured 1/13/99-3/14/99. Problem: Harness adjuster may move in crash allowing too much forward movement Call: 888-427-4829 for shoulder pad kit.
Advantage Convertible model E9022 manufactured 3/5/01-7/26/01. Problem: Tether bracket may separate from seat shell in crash. Call: 704-409-1700 option 2 for metal ring repair kit.
Freeway Toddler Seat model 101 manufactured 6/96-4/18/97. Problem: Buckle can be opened by lifting up on push-button. Call: 888-427-4829 for new buckle.
- Century** See Graco
- Champion** See Renolux
- Chrysler**
Built-in Minivan child seat

Made 6/96 - 7/96. Problem: Bolts holding seat to frame can break. Contact dealer for replacement.

Built-in Minivan child seat
1998 model year Dodge Caravan & Grand Caravan, Plymouth Voyager, Grand Voyager, & Town & Country vans. Problem: Shoulder harness webbing if incorrectly routed may fail to restrain child in crash. Contact dealer for inspection/correction of harness threading.

Built-in Minivan child seat
1996-1997 Town & Country, Dodge Caravan/Grand Caravan, Plymouth Voyager/Grand Voyagers. Problem: Latch plate may become contaminated, making harness difficult to release. Contact dealer to clean latch plate & add emergency release extender.

Collier Keyworth
Out of Business

Safe & Sound II Convertible
made 12/28/84-4/3/85. Problem: Buckle may fail in crash (single prong tongue, no writing on back.) Destroy!

Dorel/Cosco/Safety First
2525 State Street 800-544-1108
Columbus, IN 47201

Designer 22 infant seat models 02-621-SAL, 02-620-AZY, & 02-620-BEA. Made 1/3/02-2/13/02. Problem: When used as carrier handle may slip causing seat to fall forward and unbuckled child to fall. Call: 800-536-1090 for handle repair kit. Until installed do not use as carrier.

Voyager infant seat (with stroller) made 9/8/97-10/27/97 Problem: When used as a stroller the child car seat may become dislodged and fall to ground. Call: 800-221-6736 for repair kit. Do not use stroller until repaired, OK as car seat.

Turnabout & Arriva infant seats models beginning "02-" 665, 727, 728, 729, 731, 732, 733, 750, 751, 755, 757, 774, 753, 756, 758, 759, 760, 761, 762, 763, 764, 765, 770, 771, & 772. Made pre-1/31/00. Problem: When used as carrier handle may slip causing seat to fall forward and unbuckled child to fall. Call: 800-880-9435 for handle repair kit. Until kit is installed do not use as carrier.

Arriva infant seat Problem #1: model 02-729TED made 3/31/99-4/7/99 have no air bag

warning label. Call: 800-221-6736 for replacement pad. Problem #2: **Models beginning with "02-" 665, 729, 731, 732, 733, 751, 756, & 757** made 3/1/95-9/9/97. When used as carrier handle may slip causing seat to fall forward and unbuckled child to fall. Call: 800-221-6736 for repair kit. Until kit is installed do not use as carrier. Problem #3: **02-751 DDF or MMF** made 3/1/95-5/31/95. Latch release button & spring may separate when button is pushed. Destroy!

Turnabout infant seat models beginning "02-" 667, 758, 759, 760, 761, 762, 763, 764, & 765 made 3/1/95-9/9/97. Problem: Handle releases unexpectedly when carried causing seat to flip and child to fall. Call: 800-221-6736 for repair kit. Fasten harness & do not use as carrier, until kit is installed.

Dream Ride Car Bed 02-719 made 1/89-1/11/94 with blue/pink plaid cover. Problem: Cover not flame retardant. Destroy!

Dream Ride Ultra Car Bed 02-719. Made 4/94-6/95. Problem: Seat rotates too far backward in crash. Destroy!

Safe-T-Shield Convertible models 81A, 81B, 181A, 181B made 1/81-6/83 (with metal pull knobs). Problem: Pushpin holding shield may break off making it difficult to remove child from seat. Destroy!

Safe-T-Mate Convertible made 1984. Problem: Instructions show wrong location for belt when used rear-facing. Destroy!

Safe & Easy Convertible 313, Safe & Snug 323; & Luxury Safe & Snug 423 made 1/84-6/85. Problem: Cracks appear where frame attaches to shell. Destroy!

Soft Shield Convertible 02-090 & Soft Shield Deluxe 02-190, Auto Trac 02-290, Luxury 02-790, 02-890 made 10/89-6/90. Problem: Child's head goes too far forward. Destroy!

Deluxe Commuter Tray Shield Convertible model 02-086 made 11/1/87-2/10/88. Problem: Exposed foam is choking hazard. Destroy!

Touriva 5-pt. Convertible models #02-514, 02-584, & 02-518 made 8/9/97-8/22/97 with mold # "3" on top back of shell (may need to remove locking clip on seat back to see number). Problem: Belt path in shell may weaken

when used in *forward-facing reclined* position. No problem with forward-facing upright or rear-facing positions or if tethered. Call: 800-221-6736 for repair kit.

Touriva Overhead-shield Convertible models 02-014 & 02-015 made 8/9/97-8/22/97 with mold # "3" on top back of shell (may need to remove locking clip on seat back to see number). Problem: Belt path may weaken when used in *forward-facing reclined* position. No problem with rear-facing or forward-facing upright positions or if tethered. Call: 800-221-6736 for repair kit.

Touriva Safe T-Shield Convertible 02-084 (full wrap fabric cover), **02-096** (full wrap cover & pillow), **02-404** (partial wrap vinyl cover), **02-094 & 02-821** (partial wrap). Problem #1: Made 5/1/96-11/26/97. Buckle release is difficult. Call: 800-221-6736 for fabric cover. Problem #2: **Model 02-084** made 5/6/94-8/10/94. Buckle may break then harness can loosen. Destroy!

Downunder (No Recalls)
Out of Business

Early Development
Out of Business (No Recalls)

Evenflo 800-543-8954
1801 Commerce Drive
Piqua, OH 45356

All Evenflo Infant Seats with Position Right Bases. ALL Models made pre-2/10/00. Posts may bend making seat difficult to attach to base. Call: 800-316-4779 for repair kit.

Infant Seat Problem #1: Models 456 & 458 made pre-4/10/89 with molded plastic bases. Seat can exceed safe angle when used in most reclined position. Thread shoulder portion of vehicle belt through built-in plastic clip on seat back. If vehicle has no lap/shoulder belt, use seat only in first position. Call: 800-233-5921 for warning label. Problem #2: **Models 456 & 458** made 4/15/85-4/22/90 have black buckle housing & red push button. Buckle may seem secure when not fully latched. Call: 800-837-8926 for gray buckle.

Dyn-O-Mite Infant Seat

Problem #1: Models 441-446 & 448 with tubular steel frames. (Seats produced after 2/89 are not affected by recall they have only three positions.) Seat can exceed safe 70 degree maximum angle when used in the most reclined position. Thread shoulder portion of seat belt through built-in plastic clip on back of seat. Consumers whose vehicles do not have combination lap/shoulder belt should use seat only in first three positions. Call: 800-233-5921 for label. **Problem #2: Models 202, 441-446 & 448** made 4/15/85-4/22/90 have black buckle housing & red push button. Buckle may seem secure but not be fully latched. Call: 800-837-8926 for gray buckle.

SecureRide Infant Seat Model 626 made 8/15/94-3/17/95. **Problem:** Airbag warning label is mislocated on seat. Call: 800-952-5552 for label.

On My Way Infant Seat & Travel System car seat/stroller. **Problem #1: Models 207 & 492** made 12/15/95-7/27/97. Handle releases unexpectedly when carried causing seat to flip and child to fall. Call: 800-203-2138 for repair kit. Until installed do not use as carrier. **Problem #2: Model 206** made 5/7/94-5/31/95. Cracks develop on shell. Call: 800-225-3056 for plastic inserts. Use seat only with detachable base until installed.

Joy Ride Infant Seat Models 203, 205, 210, 435, & 493 made 1/1/88-12/31/98. **Problem:** Handle releases unexpectedly when carried causing seat to flip and unbuckled child to fall. Call: 800-557-3178 for repair kit. Until installed do not use as carrier.

Travel Tandem Infant Seat (Joy Ride with base). **Problem:** When tested with in-car base, shell broke and seat released from base. Call: 800-448-6924 for reinforcing plate; use without base until installed.

Bobby-Mac Champion 411; Bobby-Mac Deluxe Convertibles 412, 414, 415 made 4/15/85-4/22/90. Have black buckle housing & red push button. **Problem:** Buckle may seem secure when not fully latched. Call: 800-837-8926 for gray buckle.

One Step & One Step Deluxe Convertible models 401-409 & 223 made 4/15/85-4/22/90. Have black buckle housing & red push button. **Problem:** Buckle may seem secure when not fully latched. Call: 800-837-8926 for gray buckle.

410 Convertible made 6/88-4/89. **Problem:** Ejection of child. Call: 800-233-5921 for new harness.

Seven Year Convertible/

Booster Problem #1: Models 453 & 454 made 2/13/87-10/31/88. Black plastic pins on seat can come loose & present choking hazard. Call: 800-837-8926 for gray pins. **Problem #2: Models 453, 454, & 228** made 4/15/85-4/22/90. Have black buckle housing & red push button. Buckle may seem secure when not fully latched. Call: 800-837-8926 for gray buckle.

Triumph Convertible Model 264 made 10/20/01-1/31/02. **Problem:** The slide loop connectors holding harness may not be strong enough to properly restrain child in a crash. Call: 800-425-1967 for safety upgrade kit.

Guardian T-Shield Convertible Models 634, 643, 653, 654 & 655 made 1/31/90-5/3/90. (Gray harness straps). **Problem:** Buckle releases too easily. Call: 800-845-8813 for new buckle.

Ultara I Convertible Problem #1: Model 420 made 9/22/88-7/1/89. Buckle difficult to unlatch. Call: 800-962-7730 for new harness. **Problem #2: Model 231** made 2/8/93-8/4/93. Plastic sleeve on harness makes buckling difficult. Call: 800-837-4002 for directions on removal.

Ultara II Convertible Problem #1: Model 232 made 2/8/93-8/4/93. Plastic harness sleeve makes buckling difficult. Call: 800-837-4002 for directions on removal. **Problem #2: Model 227** made 1/5/90-6/90. Seat doesn't restrain child's forward movement. Call: 800-837-8926 for new seat.

Champion/Trooper/Scout 5-Pt Convertible. Problem #1: Model 229 made 6/1/93-12/16/96. Increased risk of chest injury in crash. Call: 800-490-7497 for kit. Use only in reclined position until installed. **Problem #2: Seats** made 10/14/96-2/6/97 allows too much forward movement increasing risk of head injury. Call: 800-233-5921 for harness adjuster assembly.

Champion/Trooper/Scout T-Shield Convertible Model 225 made 10/14/96-2/6/97. **Problem:** Allows too much forward movement increasing risk of head injury. Call: 800-233-5921 for harness adjuster assembly.

Champion/Trooper/Scout Tray Shield Convertible Model 224 **Problem #1:** made 2/8/93-8/4/93. Plastic sleeve on harness makes buckling difficult. Call: 800-837-4002 for directions on removal. **Problem #2: Model 224** made 6/1/93-11/22/96. In a crash there is an increased risk of chest injury. Call: 800-490-7497 for remedy kit. Use only in reclined position until kit is installed. **Problem #3: Seats** made 10/14/96-2/6/97. Allows too much

forward movement increasing risk of head injury. Call: 800-233-5921 for new harness adjuster assembly.

Champion/Trooper/Scout Adjust-A-Shield Convertible Problem #1: Model 219 made 11/27/95-1/22/96. Toddler section of instructions labeled for infant use. May cause user to believe infants under 20 lbs. can ride forward-facing. Call: 800-233-5921 for new instructions. **Problem #2: Seats** made 10/14/96-2/6/97. Allows too much forward movement increasing risk of head injury. Call: 800-233-5921 for harness adjuster assembly.

Two-in-One Toddler Booster Seat models 636 & 637 made 1/7/98-3/20/98. **Problem:** Back & seat base can separate when used with harness. Call: 800-985-7328. **Until resolved:** children 22-29 lbs. must use different seat; children 30-65 lbs. remove harness, use with lap & shoulder belt.

Small Shield Booster Problem #1: Models 470 & 471 made 2/13/87-10/31/88. Black plastic push pins attaching pad to seat can be removed & present a choking hazard. Call: 800-837-8926 for gray push pins. **Problem #2: Models 471, 242** made 4/15/85-4/22/90. Have black buckle housing & red push button. Buckle may seem secure when not fully latched. Call: 800-837-8926 for gray buckle.

Sidekick Booster Model 244 made 4/23/96-5/20/97. **Problem:** Shield allows too much forward movement in crash increasing risk of injury. Call: 800-233-5921 for remedy.

E-Z-On Products (No Recalls)
500 Commerce Way West, Suite 3
Jupiter, FL 33458 800-323-6598

F.B.S. See Renolux

Fisher Price 800-432-5437

Infant Seat model 9149
Made 1/1/91-2/27/91. **Problem:** Faulty shield can separate. Destroy!

Infant Seat Model 9173
made 9/1/94-10/31/94. **Problem:** Air bag warning label can not be seen when used in front seat. Destroy!

Safe Embrace Convertible Model 79700 made 5/19/97-3/29/98. **Problem:** Harness adjuster spring can break or become dislocated. If spring fails, harness adjuster may not lock

properly in crash. Bring seat to phone & Call: 800-355-8882 for repair kit.

#9100 & 9101 T-Shield Convertible. Problem #1: (Affects model 9100 seats only). Made 4/85-8/85. Shield may break during use; OR **Problem #2:** Made pre-1987. Strap may be missing button to keep straps from retracting too far; OR **Problem #3:** Seats made 1/1/85-9/1/90. Button may be missing or work loose & present choking hazard; OR **Problem #4:** Made 5/1/87-10/31/89. Shield may be hard to latch due to internal cracks. **Problem #5:** Made 1985-1/26/89. White foam pad located between seat pad & shell failed flammability tests. **Problem #6:** Made prior to 7/89. Metallic label glued to shield can become loose & creating choking hazard. If loose, peel off & discard. **Problem #7:** Made 2/5/90-3/24/90. Possible structural weakness in metal tongue. **Problem #8:** Made 2/8/91-1/24/92. Harness straps can come unfastened at back of seat. **For problems 1-8: Destroy!**

#9104 Deluxe Tray Shield Convertible made 6/15/92-9/4/92. **Problem:** Red button on seat's buckle pops up preventing latching. Destroy!

Ford See Love Seat

Freedom Ride No Recalls Out of Business

General Motors

Built-In child seats in Chevrolet Oldsmobile & Pontiac vans w/power sliding doors. Made 11/92-7/93 & 9/93-3/94. **Problem:** Needs new trim panel so belt does not get pinched in door. Call: vehicle dealer.

Built-In child seats in Chevrolet & GMC ML model vans made 5/96-9/97. **Problem:** Harness may be missing hidden piece & will not lock! Call: dealer for inspection and replacement.

Gerry See Evenflo

Graco - 888-224-6529 Century- 800-837-4044

150 Oaklands Blvd. Exton, PA 19341

Graco SnugRide Infant Seat Models 841203, 840203, 8402L01, 8402L02, 8402L03, 8442BLW, 8442BRN, 8442CYP, 8442GMP, 8442LBLW, 8442LCP, 8442LMAD, 8442LMELCA, 8442MAD, 8442YL, 8444HAB, 8444LHAB, 8444LHABCA, 8444LHIG, 8444LKER, 8444LKERCA, 8444LPLT, 8444MEL, 8446LFBK, 8446LVIN, 8446VIN, 8447JAM, 8447LHAV, 8447LHAV, 8447LJAM, 8447LLAG, 8447LNGS, 8447LNGSCA, 8447NGS, 8448LDIA, 8448LDIACA, 8448LSAR, 8457DVB, 8458FKB,

8459VL, 8463AMB, 8463GMP, 8463MPCA, 8463JUCA, 8463JUN, 8463MAN, 8463YL, 8464MAC, 8464MALLA, 8464BAG, 8464MIC, 8464MCL, 8470BUG, 8471UVB, 8478SAR, 8601FOF, & C844342 made 3/1/02-3/6/03. Seats may be missing hardware to attach carrier to base. If missing carrier may not be securely attached to base causing injury in crash. Call: 866-473-0163. *Until repaired use only without base.*

Problem #2: Models 7493G9, 7493RS, 7497HL, 7497SY, 7499LK, 7499N2, 841101, 841102, 841103, 841203, 8412T02, 8457D5, 8457DVB, 8457F3, 8457GP, 8457IND, 8457MA, 8457MV, 8457RG, 8457TMI, 8457TMP, 8457YL, 8458A5, 8458AE, 8458B7, 8458D8, 8458FKB, 8458HE, 8458HH, 8458KY, 8458N5, 8459VL, 8460LV, 8462HAV, 8462JAM, 8471UVB, 8472BLW, 8472BRN, 8472CYP, 8472GMP, 8472MAD, 8472YL, 8474HAB, 8474MEL, 8476VIN, 8477HAV, 8477JAM, 8477NGS, & 8478SAR made 8/31/99-2/28/02. Seat may be missing metal hooks or "U" bars attaching carrier to base. If missing, carrier may not be securely attached to base causing serious injury in crash. Call: 800-664-5246 for new base. *Until repaired use only without base.*

Century Infant Seats & 4-in-1 Stroller Systems with straight handles W-shaped handles not affected. Seats made 1/01/91-7/31/97. **Problem:** Handle releases unexpectedly when carried causing seat to flip & child to fall. Call: 800-865-1419 for repair kit. *Until installed do not use as carrier.*

All Century Infant Seats & 4-in-1 Infant Car Seat/Stroller Systems All models beginning "45" or "11" made 9/12/95-5/13/96 (091295-051396) and having date code 255-95 through 365-95 or 001-96 through 131-96 on buckle top (above red push button on either side of the word "infant") are affected. Destroy!

580 Infant Seat Problem #1: Models 4580, 4581, 4583, 4585 made pre 12/31/89 (8912 & lower). When adjusting or relocating straps parents may improperly rethread through metal retention slides. In sudden stop/collision, straps would not restrain child. Destroy! **Problem #2: Models 4581, 4583, & 4585** made pre 11/89 (8910 & lower). Retaining screws on carry handle may loosen & separate from seat. Destroy!

Model 4100 & 4200 Convertibles Problem #1: Seats made 4/85-2/86 (8504-8602) with "mold #1" engraved on seat above top bar. Plastic under child's bottom is too thin. **Problem #2:** Seats made 1/81-4/81 (8101-8104). Push

buttons on pad loosen presenting choking hazard. **Problem #3:** Made 1/1/81-1/1/83 (8101-8212). Buckle jams inhibiting removal of child. **Problem #4: Model 4200** Made 6/81 have wrong washers. **For Problems: 1-4** Destroy!

Model 4300 Convertible Made 4/85-2/86 (8504-8602) with "mold #1" engraved above top bar. **Problem:** Plastic under child's bottom is too thin. Destroy!

Model 4400XL Convertible Problem #1: Seats made 4/85-2/86 (8504-8602) which also have "mold #1" engraved above top bar have plastic under child's bottom that is too thin. Destroy! **Problem #2:** Seats made pre 5/86, (8604 & lower) need additional label to tell whether restraint is locked properly. Destroy!

1000, 2000, 3000 & 5000 STE Convertibles made 12/90-10/91 (9012-9110). **Problem:** Spanish labels have "debes" & "ninos" transposed at belt attachment spots. Destroy!

SmartMove 44709MTE & 44709SVR made 4/9/01-5/10/01. **Problem:** When used forward-facing harness adjustment mechanism allows webbing to slip. Child may not be properly restrained. Call: 800-837-4044 for replacement.

Smart Move Tray Shield Convertible model 4750 made 12/5/95-2/13/96 (120595-021396). To determine if seat is affected look on seat back for number on white label sewn to harness near splitter plate: WO#-138442-01, WO#-136716-01, -02, or -03. **Problem:** latch can release when seat is forward-facing & harness in slot closest to crotch. Destroy!

Encore (44612GTN & 4462WSC01) Made 4/9/01-5/10/01. **Problem:** When seat is forward-facing harness adjustment mechanism allows webbing to slip. Child may not be properly restrained. Call: 800-837-4044 for replacement.

Bravo (44622LTG, 44630LTH, 44631PFN, & 44662WSC) Made 4/9/01-5/10/01. **Problem:** When seat is forward-facing harness adjustment mechanism allows webbing to slip. Child may not be properly restrained. Call: 800-837-4044 for replacement.

Accel 45100CHT, 45100MTE, 45100STH, 45200MXM, 45600JTI, 45600MTE, 45600MTO, 45600MXM, 45600SAF, 45700GSD, & 45700LFT made 4/9/01-5/10/01. **Problem:** When seat is forward-facing harness adjustment mechanism allows webbing to slip. Child may not be properly restrained. Call: 800-837-4044 for replacement.

2000 STE T-Shield Convertible Problem #1: Made pre 6/89, (8906 & lower). Shoulder straps may be

glued (not sewn). Check loops hooked to metal plate on seat back. Destroy! **Problem #2: Models 4253, 4261, 4263, 4265 & 4266** made 12/91-4/30/92, (9112-9204). Push-button can fail allowing shield & harness to release. Destroy!

3000 STE Tray-Shield Convertible Problem #1: Fabric on shield pad has Velcro closure, child may unfasten Velcro & pull apart foam. **Problem #2: Models 4365 & 4368** made 5/7/90-6/14/90 (9005-9006). Seats with "R" at the end of model number are NOT affected. Latch tongue breaks in crash allowing child to slip out. Replacement harness kits can be identified by a "K" after the part number stamped on latch tongue. **Problem #3: Models 4353, 4365, 4368** pre 1/1/91 (9101 & lower). Instructions may not advise when to switch from rear to forward latching positions. Failure to switch to forward latching position for a child more than 30 pounds makes release difficult after crash. **Problem #4:** Seats made 9/89-4/92 (8909-9204) have red release button that rotates upward in crash making buckle release difficult. Some seats were repaired with defective red button. **For Problems: 1-4** Destroy!

3500 STE Tray-Shield Convertible made 9/89-4/92 (8909-9204). **Problem:** Red release button rotates upward in crash making buckle release difficult. Some seats were repaired with defective red button. Destroy!

5000 STE Tray-Shield Convertibles Problem #1: Models 4450, 4460, 4470, 4475 pre 1/1/91 (9101 & lower) Instructions may not advise when to switch from rear to forward latching positions. Failure to switch to forward latching position for a child more than 30 pounds makes release difficult after crash. **Problem #2:** Seats made 9/89-4/92 (8909-9204). Red release button rotates upward in crash making buckle release difficult. Some seats were repaired with defective red button. **Problem #3: Models 4470 & 4475** made 5/90-6/90 (9005-9006). Latch tongue breaks in crash allowing child to slip out. **Problems 1-3:** Destroy!

5500 STE Convertible made 9/89-4/92 (8909-9204). **Problem:** Red release button rotates upward in crash making buckle release difficult. Some seats were repaired with defective red button. Destroy!

Breverra Premiere & Breverra Contour Boosters all models with harness made 2/1/95-7/10/98. **Problem:** Buckle can crack or break. Call: 800-837-4044 for new buckle, product improvement campaign.

International Out of Business

Astroseat pre-8/81. Problem: Buckle pulls through webbing. Destroy!

Jupiter (No Recalls)

1399 Kennedy Road #22
Scarborough, Ontario M1P 2L6
800-465-5795

Kantwet See Evenflo

Kolcraft (800)453-7673

3455 West 31st Place
Chicago, IL 60623

Rock 'N Ride Infant Seat Problem #1: Model 13123 made 1/85-6/85. Plastic may crack in crash. Destroy! **Problem #2:** made pre 4/90. Plastic clips attaching pad present choking hazard if clips are loose, brittle, broken, or missing. Destroy!

Kolcraft Infant Restraint, Infant Car Seat, Infant Rider, Secura, Travel-About, Plus 4, Plus 5, & Playskool Infant Car Seat (some with strollers) **Models 1312x, 1382x, 1383x, 1384x, 1385x, 368xx, 43xx, & 7700x** made 1/1/93-6/30/99. **Problem:** Handle may move unexpectedly causing seat to rotate; may allow unbuckled child to fall out. Call: 877-776-2609 for repair kit. *Until installed do not use as carrier.*

Infant Rider, Travel-About, Plus 5, Plus 4, & Carters Travel 5 Infant Seats. Look for 5-digit model # beginning 131xx, 138xx, or 368xx made 3/4/96-9/30/96. Call: 800-453-7673 to determine if your seat is affected & how to fix it.

Dial-A-Fit Convertible made 10/1/88-8/16/89. **Problem #1:** Child's head goes too far forward in crash. Destroy! **Problem #2:** Made pre-4/90. Plastic buttons attaching pad break & present choking hazard. Destroy!

Dial-A-Fit II Convertible, Model 180-600 made 11/1/90-6/30/91. **Problem:** In testing rear-facing shell cracked. Destroy!

Perfect Fitt Convertible Problem #1: Model 180-200 made pre-10/90. Failed flammability test. Destroy! **Problem #2: Models 180-150 & 180-200** made 3/1/89-10/1/90. Allows too much forward movement in crash increasing risk of injury. Destroy! **Problem #3:** Made pre-4/1/90 white pad clips may break & present choking hazard. Destroy!

Traveler 700 Convertible Problem #1: All made after 1/1/94. Media reports raised concerns regarding performance

of seat buckle. Problem #2: **Model 150-100**, Style 13400 & 13401 made 1/1/91-8/7/91 (models with "A" after number not affected). Shield may break. Problem #3: Manufacture dates unknown. Labels may have incorrect drawings of seat. Problem #4: Made 1/24/91-6/30/93. Crotch buckle can rust. Seats with black tongue cap not affected. Problems 1-4: Destroy!

Automate T-Shield Convertible Problem #1: **Model 180-600** made 1/30/92-3/22/93. Crotch buckle rusts soiling child's clothes. Destroy! Problem #2: **Model 180-601** made 1/30/92-3/22/93. Crotch buckle can rust soiling clothes. Destroy!

Performa Tray-Shield Convertible Problem #1: Made 3/96-5/31/96. Flammable cover. Call: 800-453-7673 for replacement. Problem #2: Made 1/26/96-7/31/97. Buckle may be difficult to release after crash. Call: 800-453-7673 for new buckle.

Secure-Fit Convertibles made 1/26/96-7/31/97. Problem: In crash buckle is difficult to release. Call: 800-453-7673 for new buckle.

Playskool Convertible Problem #1: **Models 140-155 & 180-400** Made 12/89-8/90. Problem: Flammable foam seat pad. Destroy! Problem #2: **Models 77001 & 77002 w/comfort pump** made 1/1/91-6/30/93. Instruction label missing & crotch buckle can rust soiling child's clothes. Seats with black tongue cap not affected. Destroy!

Flip 'N Go Booster Problem #1: **Model 191-100 & 191-200 style 19127** made pre 3/19/87. Defect in shape of shield. Destroy!

Lin Lih Counterfeit

Problem: Import seat failed government crash test! If you see this seat for sale, or think you have purchased one, Call: 800-424-9393.

Little Cargo (No Recalls) Out of Business

Love Seats Out of Business

All Infant seats made 1/81-7/82. **Models 4477B1-4477M1 & 4477A2-4477F2** Problem: Defective plastic. Destroy!

All Non-adjustable toddler seat made 3/84-11/20/84. Lot #4477C4 (stamped on rear). Problem: Defective plastic. Destroy!

Mercedes Benz

Infant Restraints & Boosters made 2/97-7/99. Problem: Baby Smart airbag deactivation device fails to turn off passenger airbag. Call: Dealership for replacement.

Peg-Pérego 800-728-2108
3625 Independence Drive
Fort Wayne, IN 46608

All **Primo Viaggio Infant Seats or Travel Systems** made 5/20/01-2/15/02. Only seats with dark button in red circle. Problem #1: Snap & fabric interferes with adjustment mechanism. Harness may not fully latch & infant at risk. Call: 877-737-3468 for instructions. Do not use until repaired! Problem #2: Made 2/1/01-6/10/01. Problem: Left side latch may not lock seat into base causing injury or death in crash. Call: 877-737-3468 for instructions.

Porsche

Porsche Child Restraint for '97-'98 Boxters, 911 Carrera, Carrera S, 911 Carrera 4, 4S & 911 Turbo. Problem: Device deactivating air bag may not work. Air bag may deploy endangering child. Call: Dealer, do not use until re-

Playschool See Kolcraft

Pride Trimble See Evenflo

Pride Ride Convertible 832, made 1/88-4/89. Problem: Using optional armrest, child's head goes too far forward in crash. Destroy!

Click 'n Go Booster Model 890, 891 & 892 made 2/86-10/87. Problem: Failed testing. Destroy!

Questor See Evenflo

Renolux Out of Business

GT-1000 #69985, made 1/85-1/86. Problem: Seat failed test in rear-facing position. Destroy!

GT-2000 Convertible Problem #1: Seats made 1/1/92-1/31/93 foam cover compresses to absorb crash impact. Destroy!

Problem #2: Seats made 5/89-6/9/93 blue covers with red & yellow stripes fail flammability test. Destroy! Problem #3: seats made 8/15/88-10/31/88 (may be labeled Champion Children's Products GT-1000 or Model 200, F. B.S.). puzzle-shaped buckle releases too easily & seat too reclined rear-facing. Destroy!

GT-4000 Convertible Problem #1: Seats made 1/1/92-1/31/93. Foam compresses to absorb crash impact. Destroy! Problem #2: made 5/89-6/9/93 with blue cover with red & yellow stripes fail flammability test. Destroy!

GT-5000 Convertible or Model 500 Turn-A-Tot Made 2/18/90-4/29/91. Problem #1: faulty base allows too much forward movement in crash; gray seat covers with red stripe fail flammability test. Problem #2: Made 1/1/92-1/31/93 foam compresses to absorb crash impact; faulty base allows child too much forward movement in crash; gray seat covers with red stripe fail flammability test. Problem #3: Made 5/89-6/9/93 blue cover with red & yellow stripe fail flammability test. Problems 1-3 Destroy!

GT-5500 Convertible Problem #1: Made 1/1/92-1/31/93 foam compresses to absorb crash impact. Destroy! Problem #2: Seats made 5/89-6/9/93 having blue cover with red & yellow stripes fail flammability test. Destroy!

GT-7000 Convertible All models. Problem #1: Made 1/1/92-1/31/93 foam compresses too much to absorb crash impact to child's head. Problem #2: Remote attachment can overheat & smoke risking fire. Problem #3: Seats made 5/89-6/9/93 having

Safeline Kids 800-829-1625
1777 S. Bellaire St. #300
Denver, CO 80222

Sit'n'Stroll Convertible Problem #1: **Model 2240** made 4/01-10/01. Certification statement for label was printed in yellow instead of red. Call: 800-829-1625 for new label. Problem #2: **Model 3240** made 11/1/96-6/30/99. Incorrect labeling of rear-facing weight limit. Call: 800-829-1625 for new labels. Use seat rear-facing only up to 22

lbs. Problem #3: Model 3240 made 6/9/97-8/9/97 air bag warning label is missing. Call: 800-829-1625 for new pad with label.

Safety Baby 877-912-1313
PO Box 3194
Rockhill, SC 29732-9947

Snug Seat 800-336-7684

12801 E Independence Blvd
Stallings, NC 28105

Gorilla 200-1000 Special Needs made 6/26/02-1/15/03. Problem: Tether kit has washer which may rust. In a crash, tether may break causing serious injury. Call: 800-336-7684 for replacement washer.

Spelcast 600-1000 Special Needs made 6/26/02-1/15/03. Problem: Tether kit has washer which may rust. In a crash, tether may break causing serious injury. Call: 800-336-7684 for replacement washer.

Strolee Out of Business

Wee Care 599 Convertible made 12/15/80-5/29/81. Problem: Clips on armrest present choking hazard. Destroy!

609 & 610 Convertibles. Problem: Plastic may crack, examine, if cracked. Destroy!

GT-3000 Convertible made 1987-88. Problem: Seat failed crash test rear-facing. Destroy!

Quick-Click Booster 605 with 4/85 stamped on seat bottom. Problem: Seat failed crash test. Destroy!

T.R.W. See Love Seat

Virco See Pride Trimble

Volvo

All child seats! Problem: Buckle opens easily, child can unbuckle. Return seat to dealership.

XSCI 800-630-6850
4143 Sinton Rd.
Colorado Springs, CO 80907

All **Airbag Compatible Infant Seats** made 2/1/02-3/7/02. Problem: In crash child's head moves too far forward & cradle may detach causing injury or death. Do not use! Return seat to store for replacement!